



Instructions For Installing your Category 1 Control Plate CP5523

**Alexander
EQUIPMENT CO., LLC**

P. O. Box 694
Greenville, South Carolina 29642
866.833.1160 Toll Free

Patent Number 5,743,339

Congratulations on your new purchase of the Delta Hook™ Rapid Hitch System™. You will be able to attach your implements without leaving the tractor! Please check the packing list with parts included in the box and notify us of any missing parts. We hope you enjoy your new Delta Hook™ Rapid Hitch System™. We appreciate your business and all comments are welcomed!

**DUE TO THE SIZE AND WEIGHT OF THE PLATE, WE RECOMMEND TWO PEOPLE
INSTALL THE CONTROL PLATE ON THE TRACTOR.**


Items to be installed




Control Plate
CP5523




Handlebar
AG2214

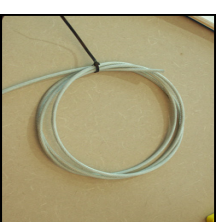

Pull Cable
AG2225

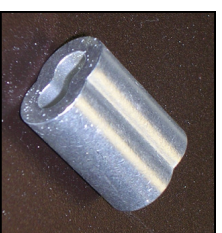


Cable Sleeve
AG2224

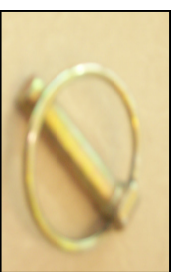

Lynch Pin
AG2014



Draw Pin
AG2219

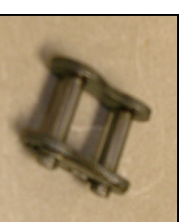

Chain Link
AG2218



Top Link Pin
AG2013

Items already installed



Locking Pin
AG2408



Spring
AG2224



Grease Fitting
AG2223

To Install Handlebar to Locking System

Caution: Locking System is spring loaded. Lay plate on a firm flat surface so that the locking pin is held into plate.

- 1) Remove cover of chain link as shown in Figure 1.
- 2) Insert handlebar with curved part out as shown in Figure 2.
- 3) Insert the spikes of the chain link into the holes of the handlebar.
- 4) Replace cover back on chain link.



FIGURE 1

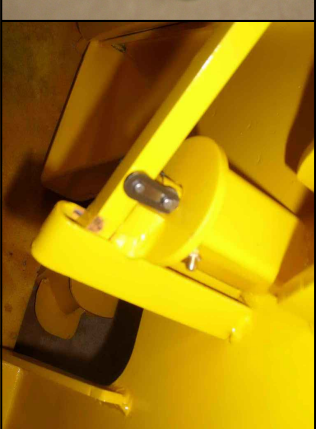


FIGURE 2

Install Control Plate to the 3-point Hitch on Tractor

- 1) Remove top link pin from Control Plate.
- 2) Insert the tractor's top link between the supports, aligning the holes. Be sure the handlebar side is facing the tractor as shown in Figure 3.
- 3) Insert the top link pin through the holes.
- 4) Secure the top link pin by inserting the lynch pin through the top link pin hole.
- 5) Insert the draw pin through the each bottom hole of the control plate and secure with the attached nut and lock washer as shown in Figure 4.
- 6) Insert the remaining draw pin through each bottom arm of your 3-point hitch as shown in Figure 5.
- 7) Secure the draw pin to the bottom arms by inserting the lynch pins through the draw pin holes.



FIGURE 3



FIGURE 4


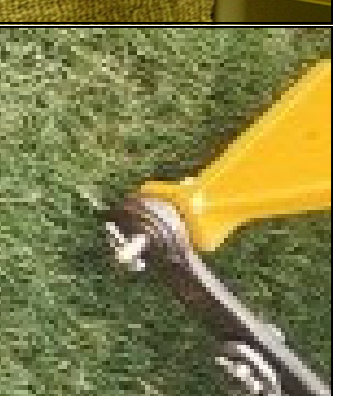


FIGURE 5

Install Cable

- 1) Run one end of cable through holes in top of handlebar.
- 2) Run other end of cable through aluminum sleeve.

Recommendation: Secure cable to tractor using a hook (not included) to prevent the cable from getting caught in the implement.

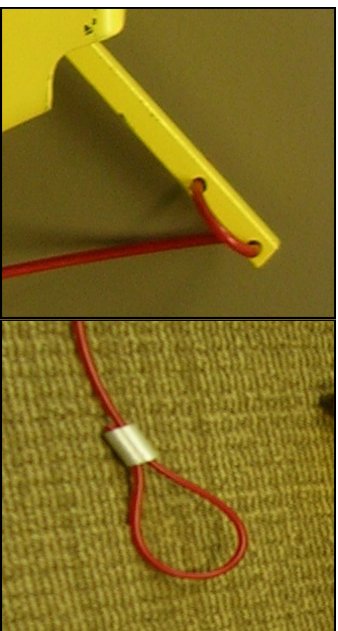

When Control Plate is installed, it should resemble photo below.



Should you encounter any problems with your Delta Hook™ Rapid Hitch System™, please contact us immediately at 866-833-1160, M-F 8:30am—5:30pm e.s.t.



Alexander
EQUIPMENT CO., LLC

P.O. Box 694
Greenville, South Carolina 29642
866.833.1160 Toll Free

Instructions For Installing Your Delta Hook™ Rapid Hitch System™ Category 1 Control Plate

**DUE TO THE SIZE AND WEIGHT OF THE PLATE, WE RECOMMEND TWO PEOPLE
INSTALL THE CONTROL PLATE ON THE TRACTOR.**